

# CORIOmaster firmware M412\_0D

Released By: Neil Baptiste 17-Feb-23

#### This software is for:

- Hardware: CORIOmaster<sup>™</sup> (C3-540), CORIOmaster mini<sup>™</sup> (C3-510) & CORIOmaster Micro<sup>™</sup> (C3-503).
- Firmware: M412 or later, use CORIOdiscover<sup>™</sup> v1.7.2.5 or later to update to this version
- Control Software: CORIOgrapher™ v3.4.3.1 or later
- For help with connecting, setting up, and using CORIOgrapher, see CORIOgrapher Help, or the Quick Start Guide that came in the box.

### **Downloads**

Download the latest firmware here: tvone.com/firmware-updates

Download the latest control software here:

CORIOgrapher: <a href="https://tvone.com/tech-support/software">https://tvone.com/tech-support/software</a>

CORIOdiscover (firmware updating tool): https://tvone.com/tech-support/software

#### Previous releases

Read details on previous releases here:

tvone.com/firmware-updates

#### Contact us

www.tvone.com

tvONE NCSA North, Central and South America

Sales: sales@tvone.com
Support: tech.usa@tvone.com

tvONE EMEA

Europe, Middle East, Africa and Asia Pacific

Sales: sales.europe@tvone.com
Support: tech.europe@tvone.com



## CORIOmaster firmware M412\_0D

Released By: Neil Baptiste 17-Feb-23

The firmware update process has been changed to improve system stability and reliability.

#### **New Features**

None

#### Fixed

- Custom EDIDs can now be loaded successfully.
- Improvements to the WebSocket packet handling, that was causing some disconnections.
- REST: AVIP ActiveQueue PLayItem command is now working.

#### **Known Issues**

 After exiting cloning and ch2 is then put back onto the Canvas – a black screen is seen instead of video. Layout shown as NULL in CORIOgrapher (During initial set up).

Workaround is as follows:

- 1. Hit Take before adding the second channel back to the canvas (after disabling cloning).
- 2. If you end up in this state, then remove channel 2 from the canvas, hit Take, and then re-add channel 2 to canvas, hit Take again (Issue is a lot less likely to happen when in Immediate Mode).
- Keying menu is listed in window properties pane when no keying module is in system.
- Removing output from canvas shows resolution as NULL in CORIOgrapher for the output in the slots status page.
- The REST API command; <a href="http://{serverIP}}/api/{{ApiVersion}}/system/comms/ethernet/restartethernet">http://{{serverIP}}/api/{{ApiVersion}}/system/comms/ethernet/restartethernet</a>
   will crash the unit if the CPU does not have the new Real Time Clock module
   fitted. Workaround = power cycle.